

# **ELECTRICAL MACHINES-II LABORATORY MANUAL**

**T. ANIL KUMAR**

Associate Professor

Department of Electrical and Electrical Engineering

**N. SINDHU**

Assistant Professor

Department of Electrical and Electrical Engineering

**K. DEVENDER REDDY**

Assistant Professor

Department of Electrical and Electrical Engineering



**INSTITUTE OF AERONAUTICAL ENGINEERING**

**DUNDIGAL – 500 043, HYDERABAD**

**INSTITUTE OF AERONAUTICAL ENGINEERING**

Dundigal, Hyderabad - 500 043

**DEPARTMENT OF ELECTRICAL AND ELECTRONICS  
ENGINEERING****ELECTRICAL MACHINES-II LABARATORY****LIST OF EXPERIMENTS**

| <b>Sl.No</b> | <b>Name of the Experiment</b>                                      | <b>Page no</b> |
|--------------|--|----------------|
| 1            | OPEN CIRCUIT & SHORT CIRCUIT TEST ON A SINGLE PHASE TRANSFORMER    | 3              |
| 2            | SUMPNERS TEST  | 10             |
| 3            | SCOTT CONNECTION OF TRANSFORMERS                                   | 15             |
| 4            | NO LOAD AND BLOCKED ROTOR TEST ON A 3- $\phi$ INDUCTION MOTOR      | 18             |
| 5            | REGULATION OF ALTERNATOR USING SYNCHRONOUS IMPEDANCE METHOD        | 23             |
| 6            | 'V' AND 'INVERTED V' CURVES OF SYNCHRONOUS MOTOR                   | 29             |
| 7            | EQUIVALENT CIRCUIT OF A SIGLE PHASE INDUCTION MOTOR                | 35             |
| 8            | BRAKE TEST ON 3- $\phi$ SQUIRREL CAGE INDUCTION MOTOR              | 40             |
| 9            | SEPARATION OF NO LOAD LOSSES IN 1- $\Phi$ TRANSFORMER              | 46             |
| 10           | DETERMINATION OF $X_d$ AND $X_q$ OF SALIENT POLE SYNCHRONOUS MOTOR | 51             |

## **OPEN CIRCUIT & SHORT CIRCUIT TEST ON A SINGLE PHASE TRANSFORMER**

**AIM:**

To perform open circuit and short circuit test on a single phase transformer and to pre-determine the efficiency, regulation and equivalent circuit of the transformer.

**APPARATUS REQUIRED:**

| Sl. No. | equipment        | Type        | Range                    | Quantity |
|---------|------------------|-------------|--------------------------|----------|
| 1       | Voltmeter        | MI          | (0-300)V                 | 1 no     |
|         |                  |             | (0-150)V                 | 1 no     |
| 2       | Ammeter          | MI          | (0-2)A                   | 1 no     |
|         |                  |             | (0-20)A                  | 1 no     |
| 3       | Wattmeter        | Dynamo type | (0-150)V LPF<br>(0-2.5)A | 1 no     |
| 4       | Wattmeter        | Dynamo type | (0-150)V UPF<br>(0-10)A  | 1 no     |
| 5       | Connecting Wires | *****       | *****                    | Required |

**Transformer Specifications:**

Transformer Rating :( in KVA) \_\_\_\_\_

Winding Details:

LV (in Volts): \_\_\_\_\_

LV side current: \_\_\_\_\_

HV (in Volts): \_\_\_\_\_

HV side Current: \_\_\_\_\_

Type (Shell/Core): \_\_\_\_\_

**Auto transformer Specifications:**

Input Voltage (in Volts): \_\_\_\_\_


Output Voltage (in Volts): \_\_\_\_\_

frequency (in Hz): \_\_\_\_\_


Current rating (in Amp): \_\_\_\_\_

**CIRCUIT DIAGRAM:**

**OPEN CIRCUIT:**

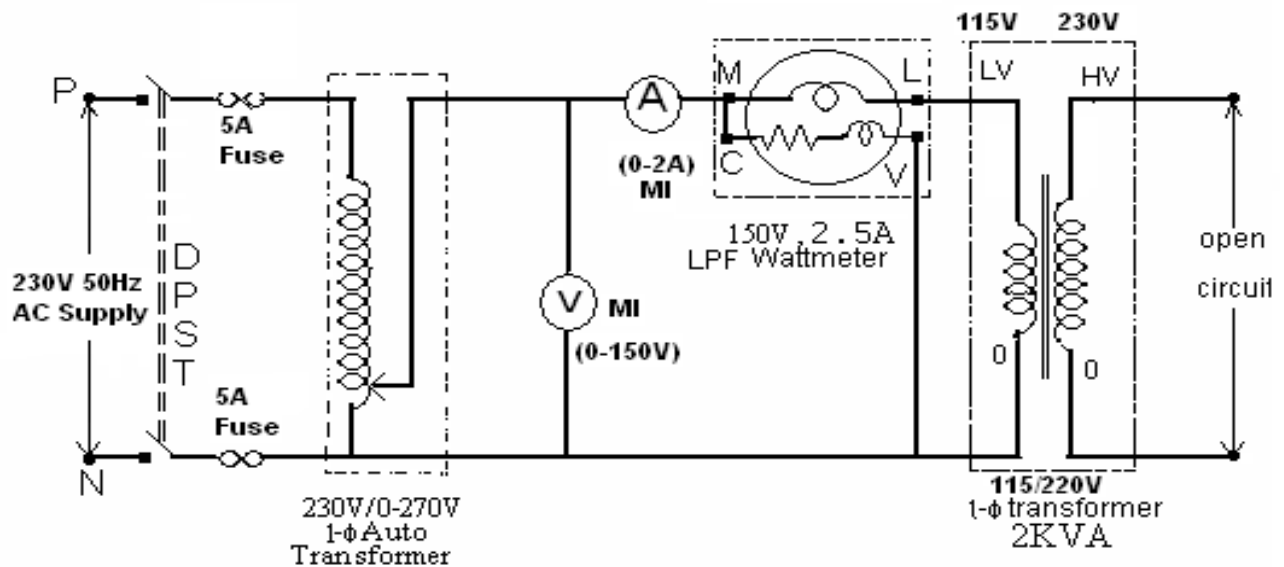

**SHORT CIRCUIT:**

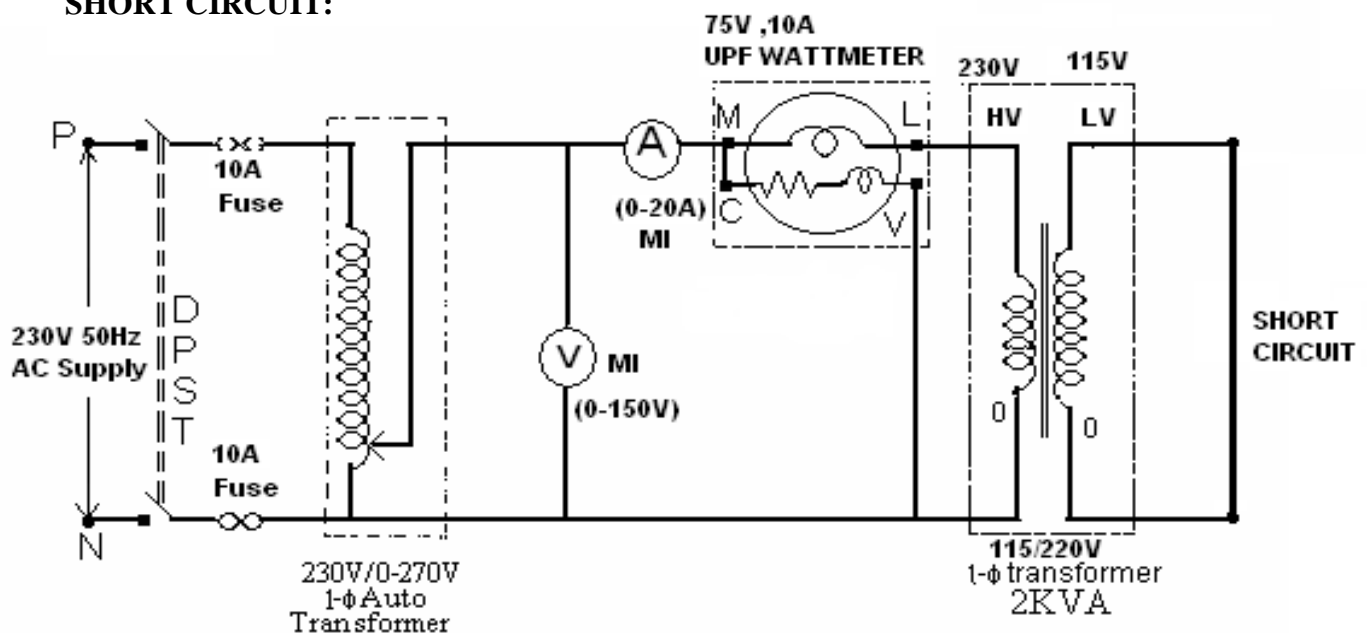

**PROCEDURE:**

**Open circuit test:**

1. Connections are made as per the circuit diagram.
2. Ensure that variac is set to zero output voltage position before starting the experiment.
3. Switch ON the supply. Now apply the rated voltage to the Primary winding by using Variac.
4. The readings of the Voltmeter, ammeter and wattmeter are noted down in Tabular form.
5. Then Variac is set to zero output position and switch OFF the supply.
6. Calculate  $R_o$  and  $X_o$  from the readings.

**Short Circuit Test:**

1. Connections are made as per the circuit diagram.
2. Ensure that variac is set to zero output voltage position before starting the experiment.
3. Switch ON the supply. Now apply the rated Current to the Primary winding by using Variac.
4. The readings of the Voltmeter, ammeter and wattmeter are noted down in Tabular form.
5. Then Variac is set to zero output position and switch OFF the supply.
6. Calculate  $R_{o1}$  and  $X_{o1}$  from the readings.

**OBSERVATIONS:**

**I) For OC test**

| Sl no. | Voltmeter reading<br>( $V_o$ ) | Ammeter reading<br>( $I_o$ ) | Wattmeter reading<br>$W_o$ | $R_o$ | $X_o$ | $\text{Cos } \phi_o$ |
|--------|--------------------------------|------------------------------|----------------------------|-------|-------|----------------------|
|        |                                |                              |                            |       |       |                      |

**II) For SC test**

| Sl no. | Voltmeter reading<br>( V <sub>SC</sub> ) | Ammeter reading<br>(I <sub>SC</sub> ) | Wattmeter reading<br>W <sub>SC</sub> | R <sub>01</sub> | Z <sub>01</sub> | X <sub>01</sub> |
|--------|--|---------------------------------------|--------------------------------------|-----------------|-----------------|-----------------|
|        |  |                                       |                                      |                 |                 |                 |

**MODEL CALCULATIONS:**

Find the equivalent circuit parameters R<sub>0</sub>, X<sub>0</sub>, R<sub>01</sub>, R<sub>02</sub>, X<sub>01</sub> and X<sub>02</sub> from the O. C. and S. C. test results and draw the equivalent circuit referred to L. V. side as well as H. V. side.

Let the transformer be the step-down transformer

Primary is H. V. side.

Secondary is L. V. side

$$R_0 = \frac{V_1}{I_w} \quad \text{where } I_w = I_0 \cos \phi_0$$

$$X_0 = \frac{V_1}{I_m} \quad \text{Where } I_m = I_0 \sin \phi_0$$

$$R_{01} = \frac{W_{SC}}{I_{SC}^2}, \quad Z_{01} = \frac{V_{SC}}{I_{SC}}$$

$$X_{01} = \sqrt{Z_{01}^2 - R_{01}^2} : X_{02} = K^2 X_{01} \quad \text{Where } K = \frac{V_2}{V_1} = \text{Transformation ratio.}$$

Calculations to find efficiency and regulation

For example at 1/2 full load

Copper losses = W<sub>sc</sub> x (1/2)<sup>2</sup> watts, where W<sub>SC</sub> = full – load copper losses

Constant losses = W<sub>0</sub> watts

Output = 1/2 KVA x cos φ [cos φ may be assumed]

Input = output + Cu. Loss + constant loss

$$\% \text{ efficiency} = \frac{\text{Output}}{\text{Input}} \times 100$$

Efficiency at different loads and P.f's

$\cos \phi = \underline{\hspace{2cm}}$

Regulation: From open circuit and Short circuit test

$$\% \text{ Regulation} = \frac{I_2 R_{02} \cos \phi \pm I_2 X_{02} \sin \phi}{V_2} \times 100$$

‘+’ for lagging power factors

‘-’ for leading power factor

| S.No | p.f. | % reg |      |
|------|------|-------|------|
|      |      | Lag   | Lead |
|      |      |       |      |

**Cosφ = 1.0**


| S.No | Load | Wcu (W) | O/P (W) | I/P (W) | η (%) |
|------|------|---------|---------|---------|-------|
|      |      |         |         |         |       |
|      |      |         |         |         |       |

**Cosφ = 0.8**


| S.No | Load | Wcu (W) | O/P (W) | I/P (W) | η (%) |
|------|------|---------|---------|---------|-------|
|      |      |         |         |         |       |
|      |      |         |         |         |       |

**GRAPHS:** Plots drawn between

- (i) % efficiency Vs output

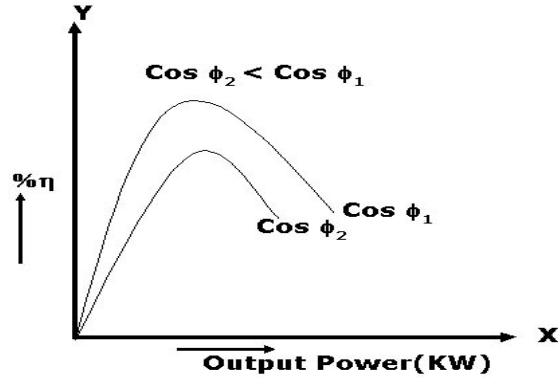

- (ii) % Regulation Vs Power factor

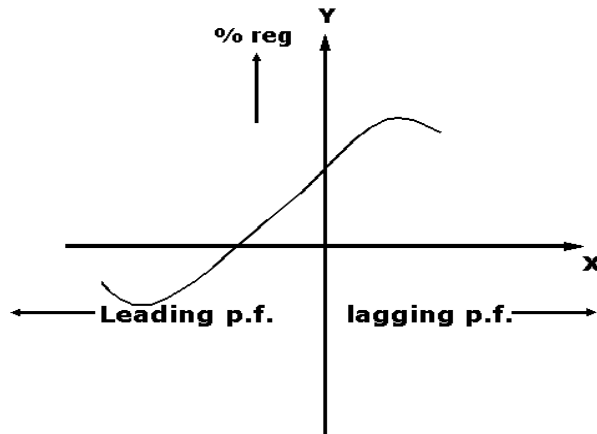

**PRECAUTIONS:**

- (i) Connections must be made tight
- (ii) Before making or breaking the circuit, supply must be switched off

**RESULT:**



## SUMPNERS TEST

**AIM:**

To determine the efficiency and losses of a given transformer accurately under full load condition.

**APPARATUS REQUIRED:**

| Sl. No. | Equipment        | Type        | Range                    | Quantity |
|---------|------------------|-------------|--------------------------|----------|
| 1       | Voltmeter        | MI          | (0-300)V                 | 1 no     |
|         |                  |             | (0-300)V                 | 1 no     |
|         |                  |             | (0-600)V                 | 1 no     |
| 2       | Ammeter          | MI          | (0-2)A                   | 1 no     |
|         |                  |             | (0-20)A                  | 1 no     |
| 3       | Wattmeter        | Dynamo type | (0-150)V LPF<br>(0-2.5)A | 1 no     |
| 4       | Wattmeter        | Dynamo type | (0-150)V UPF<br>(0-10)A  | 1 no     |
| 5       | Connecting Wires | *****       | *****                    | Required |

**Transformer Specifications:**

Two identical 1-  $\phi$  Transformers

Transformer Rating :(in KVA) \_\_\_\_\_

Winding Details:

LV (in Volts): \_\_\_\_\_

LV side current: \_\_\_\_\_

HV (in Volts): \_\_\_\_\_

HV side Current: \_\_\_\_\_

Type(Shell/Core): \_\_\_\_\_

**1 -  $\phi$  Auto transformer Specifications:**


Input Voltage (in Volts): \_\_\_\_\_

Output Voltage (in Volts): \_\_\_\_\_

Frequency (in Hz): \_\_\_\_\_

Current rating (in Amp): \_\_\_\_\_

**CIRCUIT DIAGRAM:**

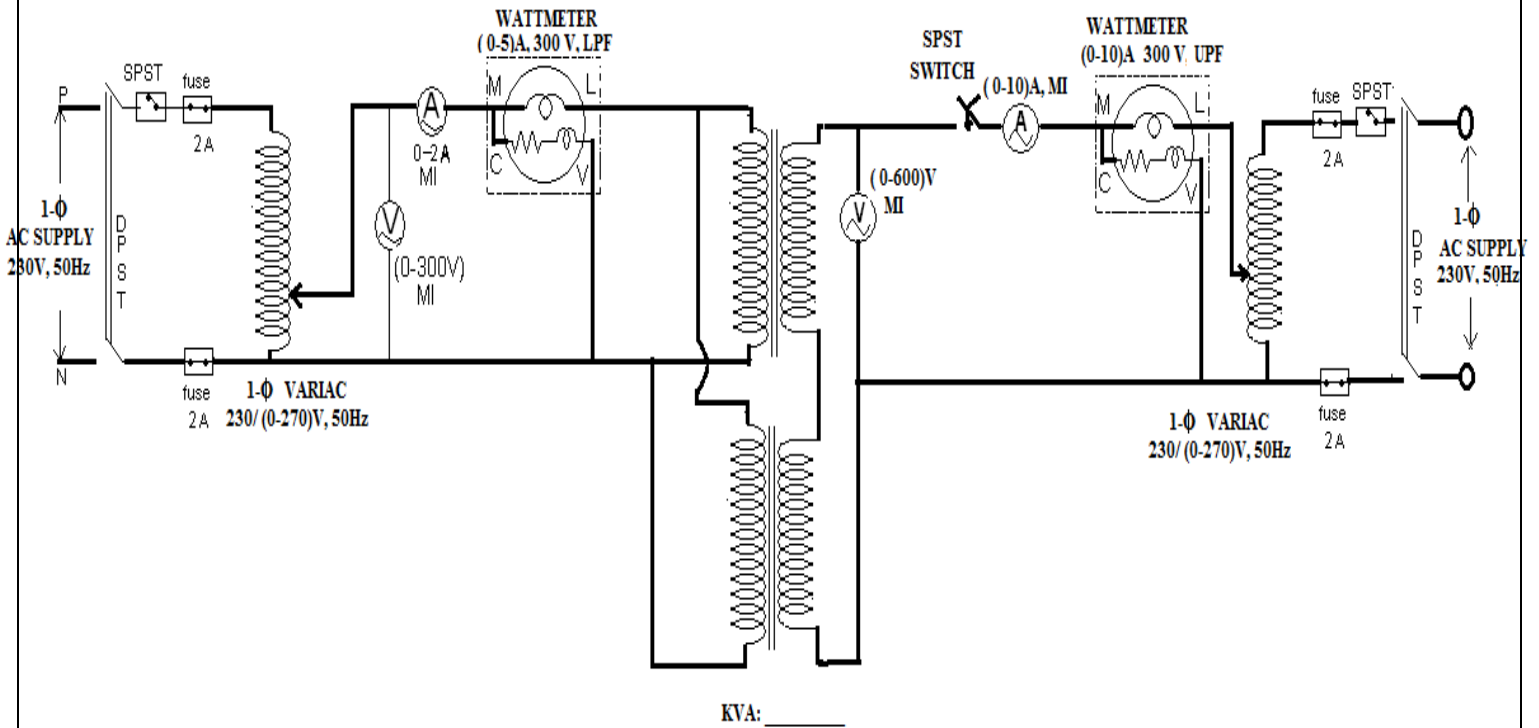

**PROCEDURE:**

1. Make the connections as per the circuit diagram.
2. The secondary winding terminals of the two transformers are connected in series with polarities in phase opposition which can be checked by means of a voltmeter.

3. Before starting the experiment, check the variacs are in minimum output voltage position.
4. Close the first DPST-1 switch and switch ON the supply.
5. Increase the variac slowly, and apply rated voltage to the primary windings of 1- $\phi$  transformers and check the voltmeter reading connected across the secondary terminals.
6. If the voltmeter reading is Zero, continue with step 8.
7. If the voltmeter reading is not zero, interchange the secondary terminals.
8. Now close the DPST-2 switch and vary the variac-2 slowly till rated current flows in the two series-connected secondaries.
9. Note down the readings of  $V_1, V_2, I_1, I_2, W_1,$  and  $W_2$  and enter them in a tabular column.
10.  $W_1 = 2P_c, W_2 = 2P_{sc}$ . Losses of each transformer =  $(W_1 + W_2)/2$
11. Now the Variacs are brought to zero voltage position and open DPST switches.

**OBSERVATIONS:**

| Sl no. | Voltmeter reading<br>$V_1$ | Voltmeter reading<br>$V_2$ | Ammeter reading<br>$I_1$ | Ammeter reading<br>$I_1$ | Wattmeter Reading<br>$W_1$ | Wattmeter Reading<br>$W_2$ | Transformer losses<br>$= (W_1 + W_2)/2$ | $\eta$<br>$= \text{op}/(\text{op} + \text{loss})$ |
|--------|----------------------------|----------------------------|--------------------------|--------------------------|----------------------------|----------------------------|---|---|
|        |                            |                            |                          |                          |                            |                            |   |   |


**MODEL CALCULATIONS:**

$$\text{Losses in each transformer} = \frac{w_i + w_c}{2} \% \eta \text{ combined} = \frac{V I_1}{V I_1 + w_i + w_c} \times 100$$

$$\text{Efficiency of each transformer (\% } \eta) = \frac{V I_1}{V I_1 + \frac{W_i}{2} + \frac{W_c}{2}} \times 100$$

**MODEL GRAPH:**

i) Output power Vs Efficiency

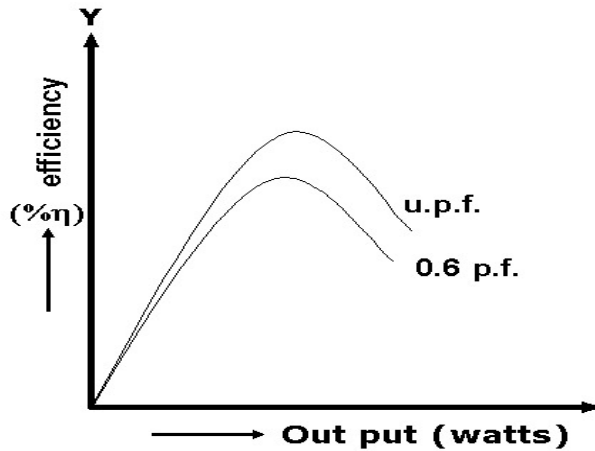

**PRECAUTIONS:**

1. Connections must be made tight
2. Before making or breaking the circuit, supply must be switched off

**RESULT:**

**VIVA QUESTIONS:**

1. What for this test is really intended?
2. Why to conduct the test on identical transformers?
3. What happens if the rated values of voltage and frequency of supply vary?
4. What are the advantages and disadvantages of this test?
5. Can you perform this test on 3 – φ star/ delta transformers?
6. What is all-day efficiency?

## SCOTT CONNECTION OF TRANSFORMERS

**AIM:**

To perform the Scott connection of transformer from three phases to two phase connection.

**APPARATUS REQUIRED:**

| Sl. No. | Equipment        | Type  | Range    | Quantity |
|---------|------------------|-------|----------|----------|
| 1       | Voltmeter        | MI    | (0-300)V | 2 no     |
|         |                  |       | (0-600)V | 2 no     |
| 2       | Ammeter          | MI    | (0-5)A   | 1 no     |
| 3       | Connecting Wires | ***** | *****    | Required |

**Transformer Specifications:**

**MAIN Transformer**

Transformer Rating :( in KVA) \_\_\_\_\_

Winding Details:

LV (in Volts): \_\_\_\_\_

LV side current: \_\_\_\_\_

HV (in Volts): \_\_\_\_\_

HV side Current: \_\_\_\_\_

Type(Shell/Core): \_\_\_\_\_

Tappings: \_\_\_\_\_

**TEASER Transformer**

Transformer Rating :(in KVA) \_\_\_\_\_

Winding Details:

LV (in Volts): \_\_\_\_\_

LV side current: \_\_\_\_\_

HV (in Volts): \_\_\_\_\_

HV side Current: \_\_\_\_\_

Type(Shell/Core): \_\_\_\_\_

Tappings: \_\_\_\_\_

**3 -  $\phi$  Auto transformer Specifications:**


Input Voltage (in Volts): \_\_\_\_\_

Output Voltage (in Volts): \_\_\_\_\_

Frequency (in Hz): \_\_\_\_\_

Current rating (in Amp): \_\_\_\_\_

**CIRCUIT DIAGRAM:**

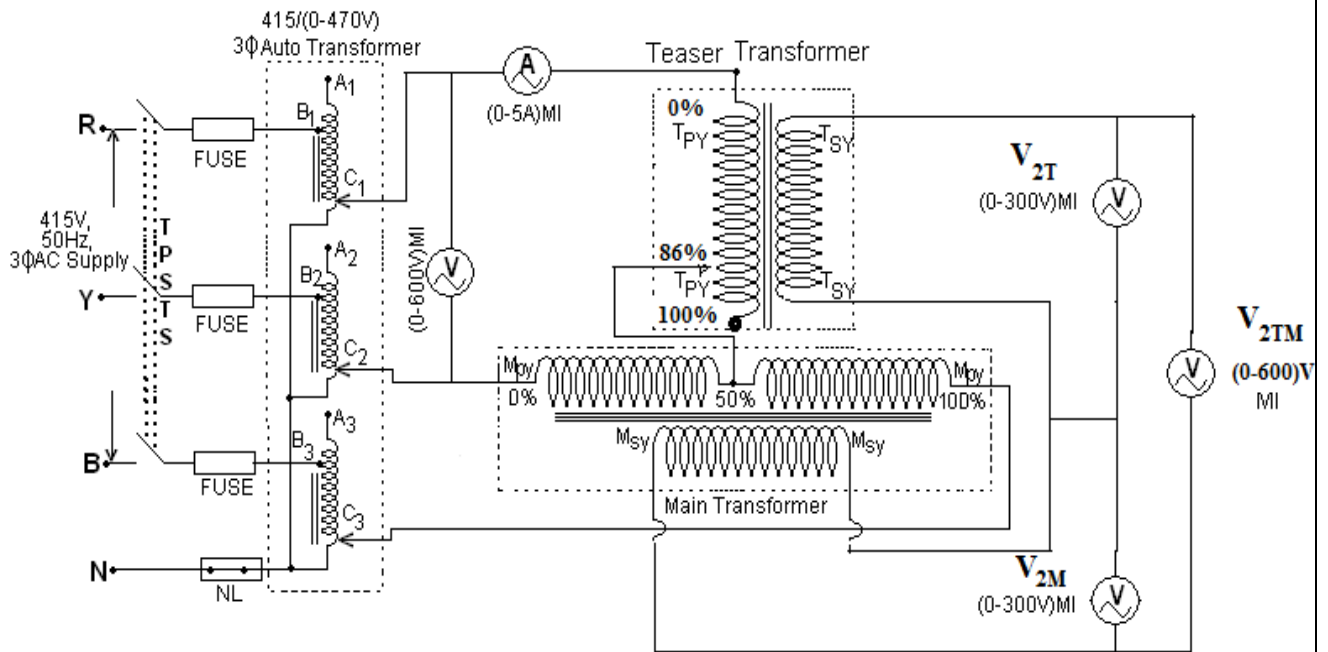

**PROCEDURE:**

1. Connections are made as per the circuit diagram
2. Ensure that output voltage of the variac is set in zero position before starting the experiment.
3. Switch ON the supply.

4. The output voltage of the variac is gradually increased in steps upto rated voltage of single phase MAIN transformer and readings are correspondingly taken in steps.
5. Enter the readings in tabular column.
6. After observations, the variac is brought to zero position and switch OFF the supply.

**CALCULATIONS:**

Prove

$$V_{2TM} = \sqrt{V_{2T}^2 + V_{2M}^2}$$

**TABULAR COLUMN:**

| Sl no. | Voltmeter reading<br>$V_1$ | Ammeter reading<br>$I_1$ | Voltmeter reading<br>$V_{2T}$ | Voltmeter reading<br>$V_{2M}$ | Voltmeter reading<br>$V_{2TM}$ | Theoretical calculation<br>$V_{2TM} = \sqrt{(V_{2T}^2 + V_{2M}^2)}$ |
|--------|----------------------------|--------------------------|-------------------------------|-------------------------------|--------------------------------|---|
|        |                            |                          |                               |                               |                                |   |

**RESULT:**

## NO LOAD AND BLOCKED ROTOR TEST ON A 3- $\phi$ INDUCTION MOTOR

### AIM:

To determine the equivalent circuit of a 3-  $\phi$  induction motor and calculate various parameters of induction motor with the help of circle diagram.

### APPARATUS REQUIRED:

| Sl. No. | Equipment        | Type                      | Range        | Quantity |
|---------|------------------|---------------------------|--------------|----------|
| 1       | Voltmeter        | MI                        | (0-600)V     | 1 no     |
| 2       | Ammeter          | MI                        | (0-10)A      | 1 no     |
| 3       | Wattmeter        | Electro dynamo meter type | 10A/600V UPF | 1 no     |
|         |                  |                           | 10A/600V LPF | 1 no     |
| 4       | Tachometer       | Digital                   | *****        | 1 no     |
| 5       | Connecting Wires | *****                     | *****        | Required |

### NAME PLATE DETAILS:

|                     |  |
|---------------------|--|
| <b>Power rating</b> |  |
| <b>Voltage</b>      |  |
| <b>Current</b>      |  |
| <b>Speed(RPM)</b>   |  |



|           |  |
|-----------|--|
| Frequency |  |
| PF        |  |


**3-  $\phi$  Auto transformer Details:**

Input Voltage: \_\_\_\_\_ (Volt)

Output Voltage: \_\_\_\_\_ (Volt)

Current: \_\_\_\_\_ (Amp.)

**CIRCUIT DIAGRAM:**

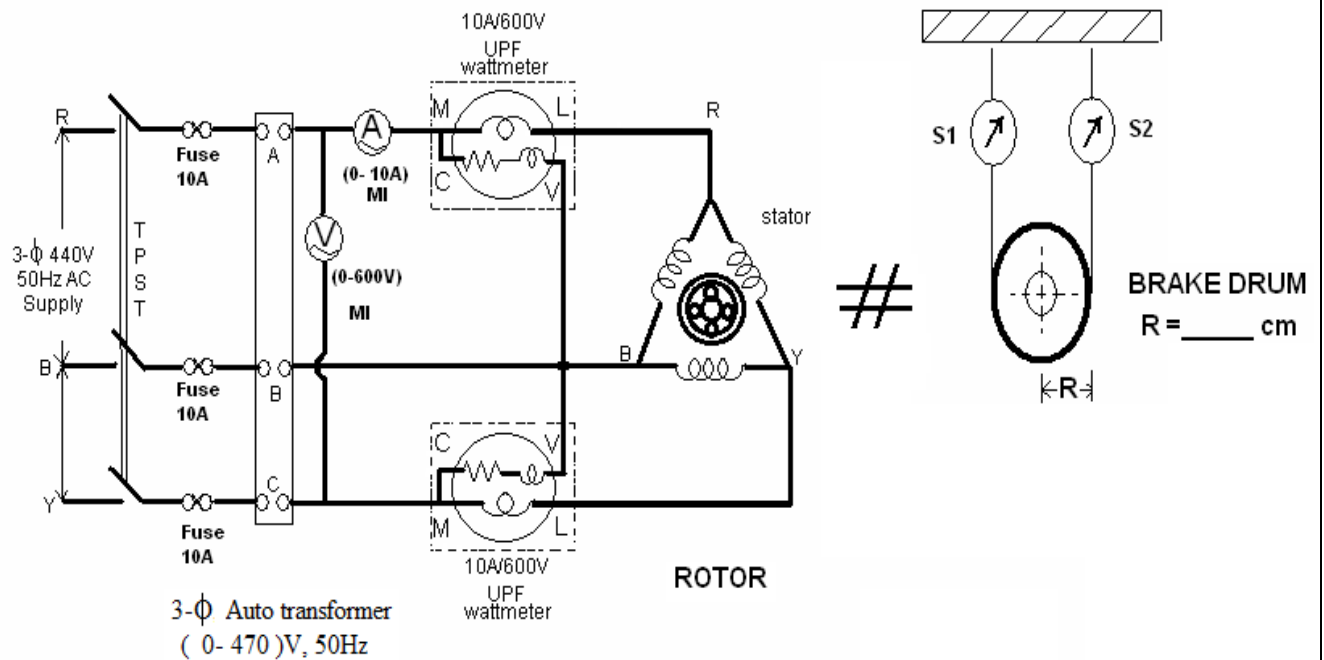

**PROCEDURE:**

**NO LOAD TEST:**

1. Connections are made as per the circuit diagram.

2. Ensure that the 3-  $\phi$  variac is kept at minimum output voltage position and belt is freely suspended.
3. Switch ON the supply. Increase the variac output voltage gradually until rated voltage is observed in voltmeter. Note that the induction motor takes large current initially, so, keep an eye on the ammeter such that the starting current current should not exceed 7 Amp.
4. By the time speed gains rated value, note down the readings of voltmeter, ammeter, and wattmeter.
5. Bring back the variac to zero output voltage position and switch OFF the supply.

**BLOCKED ROTOR TEST:**

1. Connections are as per the circuit diagram.
2. The rotor is blocked by tightening the belt.
3. A small voltage is applied using 3-  $\phi$  variac to the stator so that a rated current flows in the induction motor.
4. Note down the readings of Voltmeter, Ammeter and Wattmeter in a tabular column.
5. Bring back the Variac to zero output voltage position and switch OFF the supply.

**OBSERVATIONS:**

**No Load Test:**


| Sl no. | Voltmeter reading<br>$V_{nl}$ | Ammeter reading<br>$I_{nl}$ | Wattmeter reading |       | $W_{nl} (P_{nl})$ |
|--------|-------------------------------|-----------------------------|-------------------|-------|-------------------|
|        |                               |                             | $W_1$             | $W_2$ | $W_1+W_2$         |
|        |                               |                             |                   |       |                   |

**Blocked Rotor Test**

| Sl no. | Voltmeter reading<br>$V_{br}$ | Ammeter reading<br>$I_{br}$ | Wattmeter reading |       | $W_{br} (P_{br})$ |
|--------|-------------------------------|-----------------------------|-------------------|-------|-------------------|
|        |                               |                             | $W_1$             | $W_2$ | $W_1+W_2$         |
|        |                               |                             |                   |       |                   |

Measurement of stator winding resistance ( $r_1$ ):

**CIRCUIT DIAGRAM:**

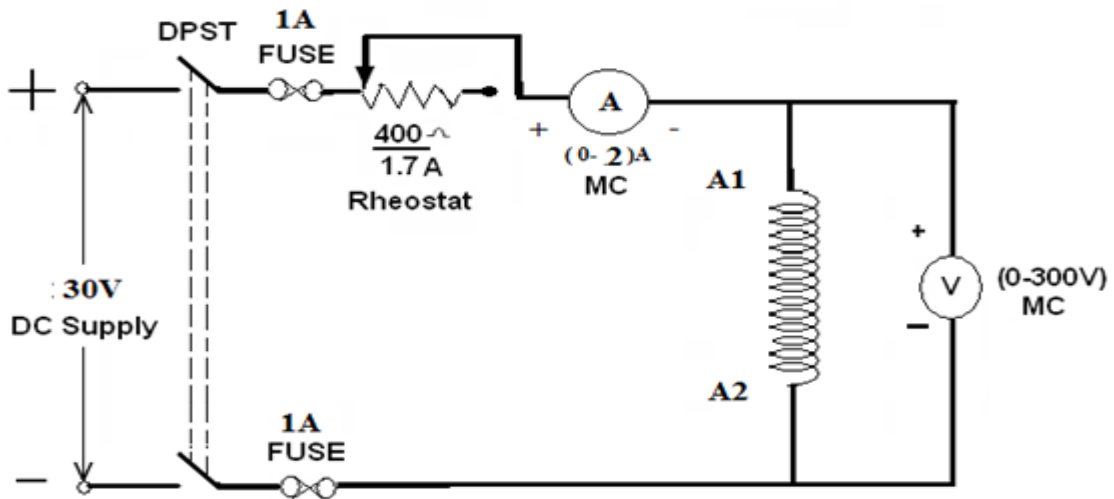

**TABULAR COLUMN:**

| S no. | Voltage (v) | Ammeter (I) | Resistance (R) |
|-------|-------------|-------------|----------------|
|       |             |             |                |

**Procedure to find  $r_1$ :**

1. Connections are made as per the circuit diagram
2. Switch ON the supply. By varying the rheostat, take different readings of ammeter and voltmeter in a tabular column.

3. From the above readings, average resistance  $r_1$  of a stator is found

**Measurement of Stator resistance**

1. Connect the circuit as per the circuit diagram shown in fig (2).
2. Keeping rheostat in maximum resistance position switch on the 220 V Dc supply.
3. Using volt-ammeter method measure the resistance of the stator winding.
4. After finding the stator resistance,  $R_{dc}$  must be multiplied with 1.6 so as to account for skin effect i.e.  $R_{ac} = 1.6 R_{dc}$ .

**MODEL CALCULATIONS:**

$$G_0 = \frac{W_0}{3V^2} , Y_0 = \frac{I_0}{V} , B_0 = \sqrt{Y_0^2 - G_0^2}$$

$$Z_{01} = \frac{V_{sc}}{I_{sc}} , R_{01} = \frac{W_{sc}}{3xI_{sc}^2} , X_{01} = \sqrt{Z_{01}^2 - R_{01}^2}$$

***For circle diagram***

$$\cos \phi_0 = \frac{W_0}{\sqrt{3} V_0 I_0} , \quad \phi_0 = \cos^{-1} \left( \frac{W_0}{\sqrt{3} V_0 I_0} \right)$$

$$\cos \phi_0 = \frac{W_{sc}}{\sqrt{3} V_{sc} I_{sc}} , \quad I_{sN} = I_{sc} \left( \frac{V_0}{V_{sc}} \right)$$

**PRECAUTIONS:**

1. Connections must be made tight
2. Before making or breaking the circuit, supply must be switched off

**RESULT:**

**VIVA Questions:**

1. Explain why the locus of the induction motor current is a circle.
2. What is the difference between the transformer equivalent circuit and induction motor equivalent circuit?
3. What are the reasons in conducting no-load test with rated voltage and blocked-rotor test with rated current?
4. Why do you choose LPF wattmeter in load test and hpf wattmeter in blocked rotor test?
5. How do you reverse the direction of rotation of induction motor?
6. What are the various applications of this motor?

## **REGULATION OF ALTERNATOR USING SYNCHRONOUS IMPEDANCE METHOD**

**AIM:**

To find the regulation of a 3 -  $\phi$  alternator by using synchronous impedance method.

**APPARATUS REQUIRED:**


| Sl. No. | Equipment        | Type       | Range              | Quantity |
|---------|------------------|------------|--------------------|----------|
| 1       | Voltmeter        | MI         | (0-300/600)V       | 1 no     |
| 2       | Ammeter          | MI         | (0-5/10)A          | 1 no     |
| 3       | Ammeter          | MI         | (0-2.5/5)A         | 1 no     |
| 3       | Rheostat         | Wire-wound | 400 $\Omega$ /1.7A | 1 no     |
|         |                  |            | 145 $\Omega$ /2A   | 2 no     |
| 4       | Tachometer       | Digital    | *****              | 1 no     |
| 5       | Connecting Wires | *****      | *****              | Required |

**NAME PLATE DETAILS:**

| DC Motor(prime mover) | 3- $\phi$ Alternator |
|-----------------------|----------------------|
| KW :                  | Power Rating:        |
| Voltage :             | PF :                 |
| Current :             | Line voltage:        |
| Speed :               | Speed                |
| Exctn : Shunt         | Exctn Voltage:       |
| Voltage :             | Rated Current :      |

|                 |  |
|-----------------|--|
| Field current:: |  |
|-----------------|--|

**CIRCUIT DIAGRAM:**

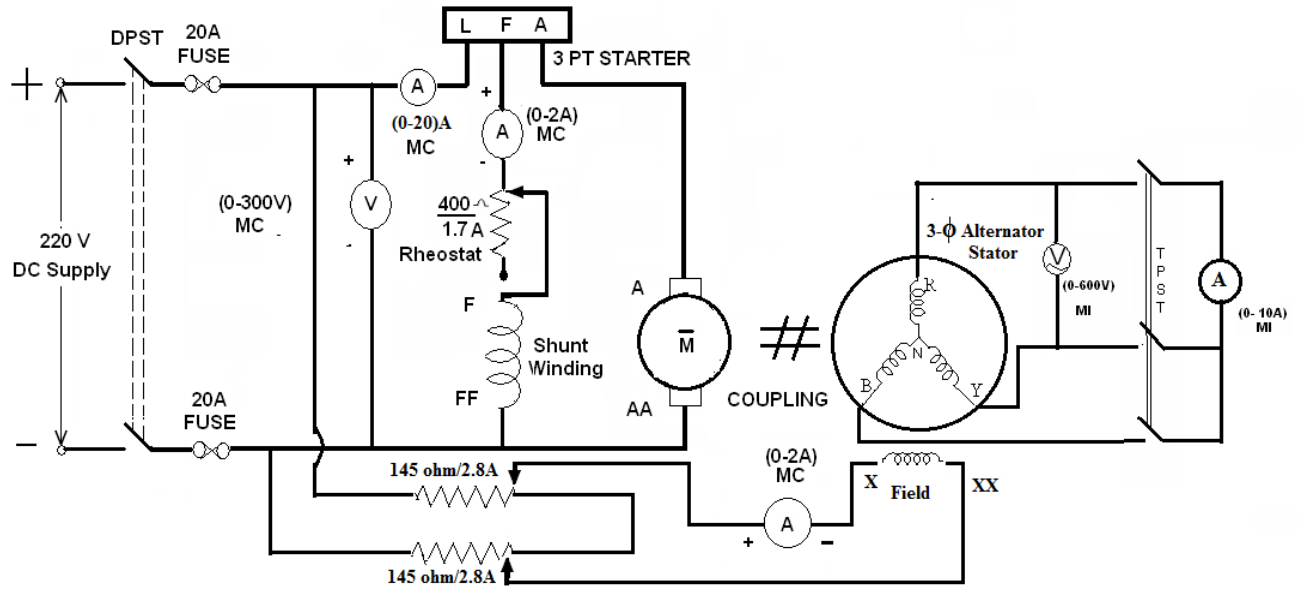

**PROCEDURE:**

**Open Circuit Test:**

1. Make the connections as per the circuit diagram.
2. Before starting the experiment, the potential divider network in the alternator field circuit and field regulator rheostat of motor circuit is set minimum resistance position.
3. Switch ON the supply and close the DPST switch. The DC motor is started by moving starter handle.
4. Adjust the field rheostat of DC motor to attain rated speed (equal to synchronous speed of alternator)
5. By decreasing the field resistance of Alternator, the excitation current of alternator is increased gradually in steps.

6. Note the readings of field current, and its corresponding armature voltage in a tabular column.
7. The voltage readings are taken upto and 10% beyond the rated voltage of the machine.

**Short Circuit Test:**

1. For Short circuit test, before starting the experiment the potential divider is brought back to zero output position, i.e., resistance should be zero in value.
2. Now close the TPST switch.
3. The excitation of alternator is gradually increased in steps until rated current flows in the machine and note down the readings of excitation current and load current (short circuit current)
4. Switch OFF the supply.

**OBSERVATIONS:**

| Sl no. | OC test                                |  | Sl no. | S.C. test                            |                                 |
|--------|--|--|--------|--------------------------------------|---------------------------------|
|        | Field current in Amp.(I <sub>f</sub> ) | OC voltage per phase (V <sub>o</sub> ) |        | Field current I <sub>f</sub> ( Amp.) | SC current I <sub>sc</sub> Amp. |
|        |  |  |        |                                      |                                 |
|        |  |  |        |                                      |                                 |
|        |  |  |        |                                      |                                 |


**Procedure to find Armature resistance of alternator:**

1. Connections are made as per the circuit diagram.
2. Switch ON the supply. By varying the rheostat, take different readings of ammeter and voltmeter in a tabular column.



3. From the above readings, average resistance  $R_a$  of a armature is found out.

**Connection diagram to find  $R_a$**

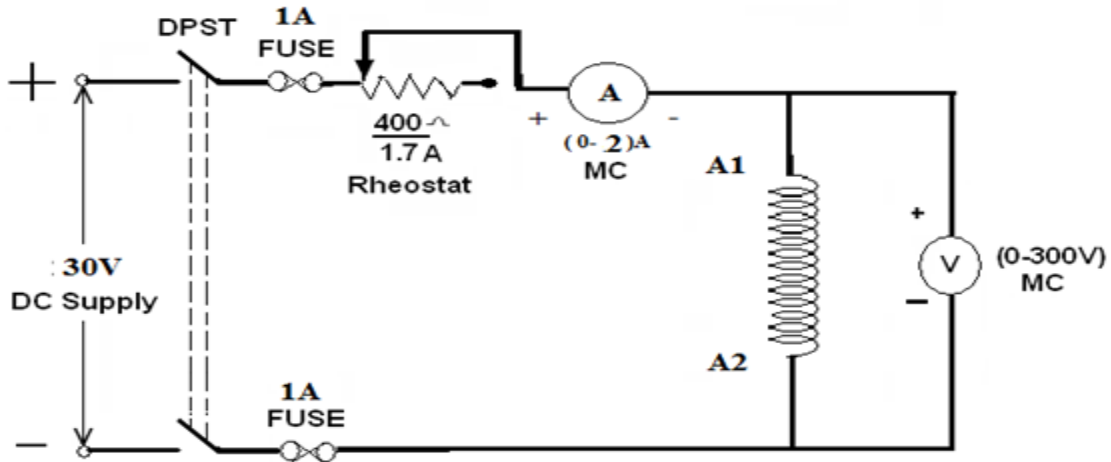

**OBSERVATIONS:**

| Sl no. | Armature current<br>I(amp) | Armature voltage<br>$V_a$ (volts) | $R_{dc}=V / I$ |
|--------|----------------------------|-----------------------------------|----------------|
|        |                            |                                   |                |
|        |                            |                                   |                |

**Procedure to find synchronous impedance from OC and SC tests:**

1. Plot open circuit voltage, short circuit current verses field current on a graph sheet.
2. From the graph, the synchronous impedance for the rated value of excitation is calculated.
3. The excitation emf is calculated at full load current which is equal to the terminal voltage at No load.

4. The voltage regulation is calculated at rated terminal voltage.

**MODEL CALCULATIONS:**

$$Z_s = \frac{V_{oc}}{I_{sc}} \text{ for the same } I_f \text{ and speed: } X_s = \sqrt{Z_s^2 - R_a^2} \quad [ \because R_a \text{ R}_{dc} ]$$

Generated emf of alternator on no load is

$$E_0 = \sqrt{(v \cos \phi + I_a R_a)^2 + (v \sin \phi \pm I_a X_s)^2}$$

+ for lagging p.f.

- for leading p.f.

The percentage regulation of alternator for a given p.f. is

$$\% \text{ Reg} = \frac{E_0 - V}{V} \times 100$$

Where


$E_0$  – generated emf of alternator (or excitation voltage per phase)

$V$  – full load, rated terminal voltage per phase.

**MODEL GRAPHS:**

Draw the graph between  $I_f$   $V_s$   $E_0$  per phase

and  $I_f$   $V_s$   $I_{SC}$

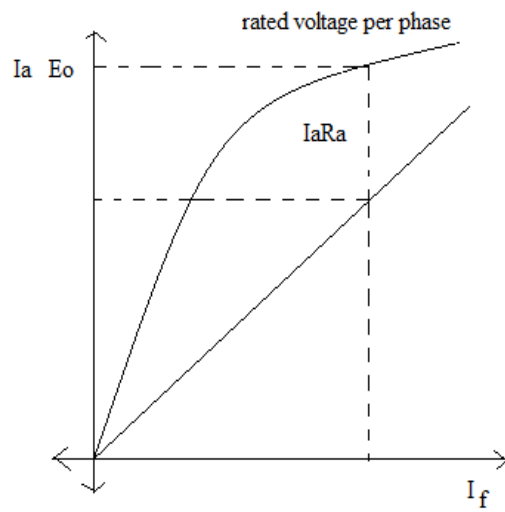

**PRECAUTIONS:**

- (iii) Connections must be made tight
- (iv) Before making or breaking the circuit, supply must be switched off

**RESULT:**

## ‘V’ AND ‘INVERTED V’ CURVES OF SYNCHRONOUS MOTOR

### AIM:

To plot the ‘v’ and ‘inverted v’ curves of Synchronous motor.

### APPARATUS REQUIRED:

| Sl. No. | Equipment        | Type               | Range              | Quantity |
|---------|------------------|--------------------|--------------------|----------|
| 1       | Voltmeter        | MI                 | (0-600)V           | 1 no     |
| 2       | Ammeter          | MC                 | (0-2.5)A           | 1 no     |
|         |                  | MI                 | (0-10)A            | 1 no     |
| 3       | Rheostat         | Wire-wound         | 400 $\Omega$ /1.7A | 1 no     |
| 4       | Tachometer       | Digital            | *****              | 1 no     |
| 5       | Wattmeter        | Electrodynamometer | 10A, 600V UPF      | 1 no     |
|         |                  |                    | 10A , 600V LPF     | 1 no     |
| 6       | Connecting Wires | *****              | *****              | Required |

### NAME PLATE DETAILS

| <b>3- <math>\phi</math> Synchronous motor</b> |  |
|---|--|
| Power Rating:                                 |  |
| PF  |  |
| Line voltage:                                 |  |
| Speed   |  |

|                         |  |
|-------------------------|--|
| Freq.                   |  |
| Rated Current :         |  |
| Field current ( $I_f$ ) |  |
| Field Voltage ( $V_f$ ) |  |

**3-  $\phi$  Auto transformer details**


Input voltage: \_\_\_\_\_(Volt)

Output Voltage : \_\_\_\_\_(Volt)

Frequency. : \_\_\_\_\_(Hz)

Current: \_\_\_\_\_(Amp)

**CIRCUIT DIAGRAM:**

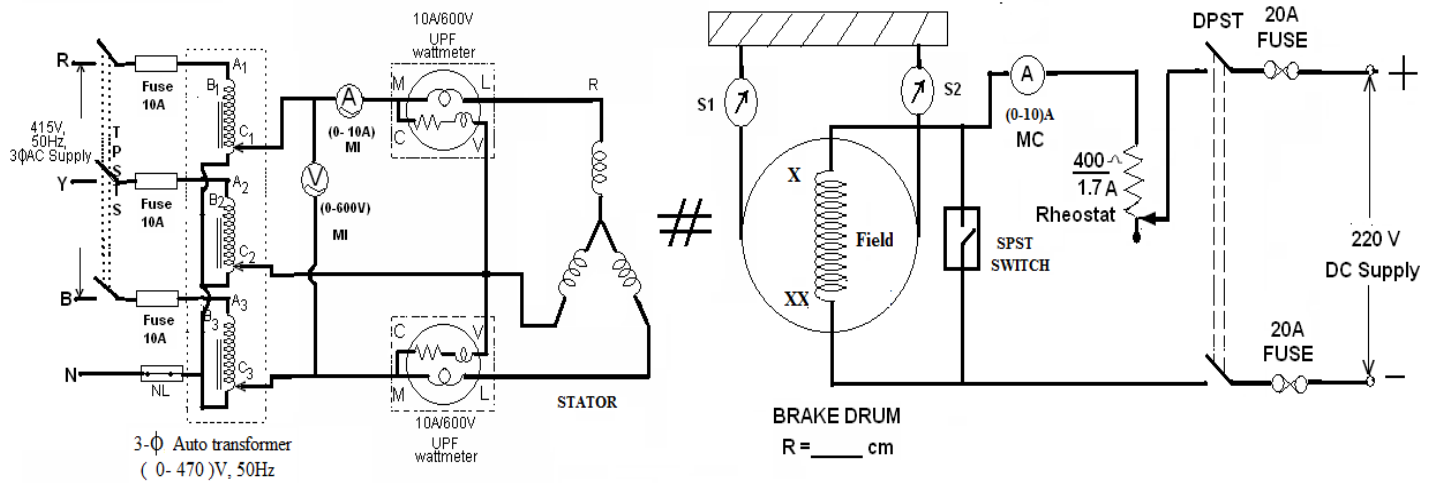

**PROCEDURE:**

1. Connections are made as per the circuit diagram.

2. Opening the SPST switch connected across the field DC supply is given to the field and field current is adjusted to 0.3A ( 20% of rated field current)
3. The DC supply to the field is removed and SPST switch is connected across the field by closing the switch
4. As 3-  $\phi$  , 440V, 50Hz AC supply is applied to 3-  $\phi$  dimmer stator keeping it in minimum output position, keeping it prior to that motor is kept in no load state.
5. Gradually supply voltage to synchronous motor is increased and then motor starts running as squirrel cage induction motor. The direction of rotation is observed. if it is not proper then supply phase sequence is altered.
6. Observing  $I_a$ , the voltage is gradually increased. It will reach a high value and suddenly falls to a low value.
7. At that instant, open SPST switch connected across the field. The DC supply is then given to the field. Then the motor is pulled into synchronism and motor now works as a synchronous motor.
8. Gradually the supply voltage to stator is increased by observing the armature current. If  $I_a$ , increases above the rated value then increase  $I_f$  such that  $I_a$  will be within limits and thus full rated supply voltage is gradually given to the motor. Now motor will work as synchronous motor with full rated voltage.
9. By varying  $I_f$  in steps, armature currents are recorded at no-load.
10. By applying half of full load on motor,  $I_f$  and  $I_a$  are recorded again. The same experiment is repeated at  $3/4^{\text{th}}$  load, full load and corresponding readings are recorded.
11. Completely removing the load on motor, the 3-  $\phi$  supply to stator and then the DC supply to the field are switched OFF

**OBSERVATION TABLE:**

| Sl no. | Supply voltage | Wattmeter W1 | Wattmeter W2 | Field current $I_f$ (Amp) | Armature current $I_a$ (Amp) | $\text{Cos } \phi$ |
|--------|----------------|--------------|--------------|---------------------------|------------------------------|--------------------|
|        |                |              |              |                           |                              |                    |

**ELECTRICAL MACHINES-II LABORATORY**

Load 1 : 18.1% FL    N = 1500 rpm     $V_L = 415V$      $S_1 = 2.2 \text{ kg}$      $S_2 = 5.2 \text{ kg}$

| $I_f$ | $I_a$ | $W_1$ | $W_2$ | $Tan \phi = \frac{\sqrt{3} (W_1 - W_2)}{(W_1 + W_2)}$ | $\phi$ | $Cos \phi$ |
|-------|-------|-------|-------|---|--------|------------|
| (A)   | (A)   | (W)   | (W)   |   |        |            |
|       |       |       |       |   |        |            |

Load 2 : 39.2% FL    N = 1500 rpm     $V_L = 415V$      $S_1 = 3.5 \text{ kg}$      $S_2 = 9 \text{ kg}$


| $I_f$ | $I_a$ | $W_1$ | $W_2$ | $Tan \phi = \frac{\sqrt{3} (W_1 - W_2)}{(W_1 + W_2)}$ | $\phi$ | $Cos \phi$ |
|-------|-------|-------|-------|---|--------|------------|
| (A)   | (A)   | (W)   | (W)   |   |        |            |
|       |       |       |       |   |        |            |

**CALCULATIONS:**

$$\text{Power factor} = \text{Cos} \left[ \tan^{-1} \left( \frac{\sqrt{3}(W_1 - W_2)}{W_1 + W_2} \right) \right]$$

$$\phi = \text{Tan}^{-1} \left[ \frac{\sqrt{3} (W_1 - W_2)}{(W_1 + W_2)} \right]$$

**MODEL GRAPHS:**

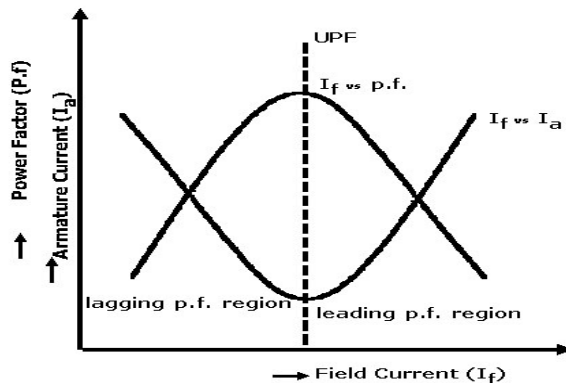

**RESULT:**

**VIVA Questions:**

1. What are the difficulties in starting a synchronous motor?
2. What are the commonly employed methods of starting a synchronous motor?
3. What are the applications of synchronous motor?
4. What is synchronous condenser?
5. What do you understand by hunting?



## EQUIVALENT CIRCUIT OF A SIGLE PHASE INDUCTION MOTOR

### AIM:

To determine the equivalent circuit parameters of a single phase induction motor by performing the no- load and blocked rotor tests.

### APPARATUS REQUIRED:

| Sl. No. | Equipment        | Type        | Range                   | Quantity |
|---------|------------------|-------------|-------------------------|----------|
| 1       | Voltmeter        | MI          | (0-300)V                | 1 no     |
| 2       | Ammeter          | MI          | (0-10)A                 | 1 no     |
| 3       | Wattmeter        | Dynamo-type | (0-300)V LPF<br>(0-10)A | 1 no     |
| 4       | Wattmeter        | Dynamo-type | (0-150)V UPF<br>(0-10)A | 1 no     |
| 5       | Connecting Wires | *****       | *****                   | Required |


### 1 - $\phi$ Induction motor specifications:

Name plate details

| Sl. no. | Quantity      |  |
|---------|---------------|--|
| 1       | rated power   |  |
| 2       | Rated voltage |  |

|   |                 |               |
|---|-----------------|---------------|
| 3 | Current         |               |
| 4 | Speed(RPM)      |               |
| 5 | Cos $\phi$ (pf) |               |
| 6 | Frequency       |               |
| 7 | rotor           | Squirrel cage |

**CIRCUIT DIAGRAM:**

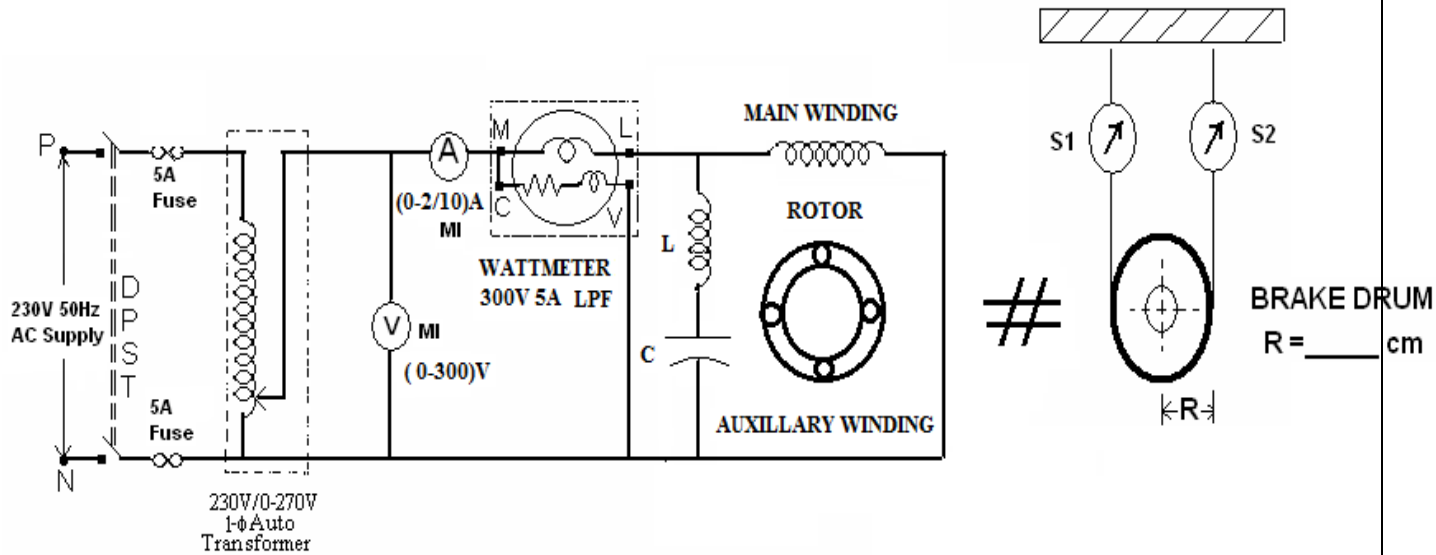

**PROCEDURE:**

**No load Test:**

1. The circuit connections are made as per the circuit diagram.
2. Be sure that variac (auto transformer) is set to zero output voltage position before starting the experiment.
3. Now switch ON the supply and close the DPST switch.
4. The variac is varied slowly, until rated voltage is applied to motor and rated speed is obtained.
5. Take the readings of Ammeter, Voltmeter and wattmeter in a tabular column.

6. The variac is brought to zero output voltage position after the experiment is done, and switch OFF the supply.

**Blocked Rotor Test:**

1. To conduct blocked rotor test, necessary meters are connected to suit the full load conditions of the motor.
2. Connections are made as per the circuit diagram.
3. Before starting the experiment variac (auto transformer) is set to zero output voltage position.
4. The rotor (shaft) of the motor is held tight with the rope around the brake drum.
5. Switch ON the supply, and variac is gradually varied till the rated current flows in the induction motor.
6. Readings of Voltmeter, Ammeter, and wattmeter are noted in a tabular column.
7. The variac is brought to zero output voltage position after the experiment is done, and switch OFF the supply.
8. Loosen the rope after the experiment is done.

**Calculation for No-Load Test:**

$$V_o I_o \cos \phi_o = W_o$$

$$\cos \phi_o = \frac{W_o}{V_o I_o}$$

$$Z_o = \frac{V_o}{I_o}$$

$$X_o = Z_o \sin \phi_o$$

$$X_o = X_1 + \frac{1}{2}(X_2 + X_m)$$

$$X_m = 2(X_o - X_1) - X_2$$

**Calculation For Blocked Rotor Test:**

$$Z_{sc} = \frac{V_{sc}}{I_{sc}}$$

$$R_{sc} = \frac{W_{sc}}{2 I_{sc}}$$

$r_1$  is the DC resistance of stator of motor

$$r_2 = R_{sc} - r_1$$

$$x_1 + x_2 = X_{sc}$$

since leakage reactance can't be separated out, it is common practice to assume  $x_1 = x_2$

$$x_1 = x_2 = \frac{X_{sc}}{2} = X_{sc} = \frac{1}{2} \sqrt{Z_{sc}^2 - R_{sc}^2}$$

**OBSERVATIONS:****For NO-Load Test:**

| Sl no. | Voltmeter reading | Ammeter reading | Wattmeter reading |
|--------|-------------------|-----------------|-------------------|
|        | $V_o$             | $I_o$           | $W_o$             |
|        |                   |                 |                   |

**For Blocked Rotor Test:**


| Sl no. | Voltmeter reading | Ammeter reading | Wattmeter reading |
|--------|-------------------|-----------------|-------------------|
|        | $V_{sc}$          | $I_{sc}$        | $W_{sc}$          |
|        |                   |                 |                   |

**PROCEDURE:**

1. Connections are made as per the circuit diagram.

2. Initially rheostat is set at maximum resistance position.
3. Switch ON the supply, and vary the rheostat gradually and note down the readings of ammeter and voltmeter
4. For the corresponding values, average of  $r_1$  is taken.

**Circuit diagram for measurement of  $R_1$  :**

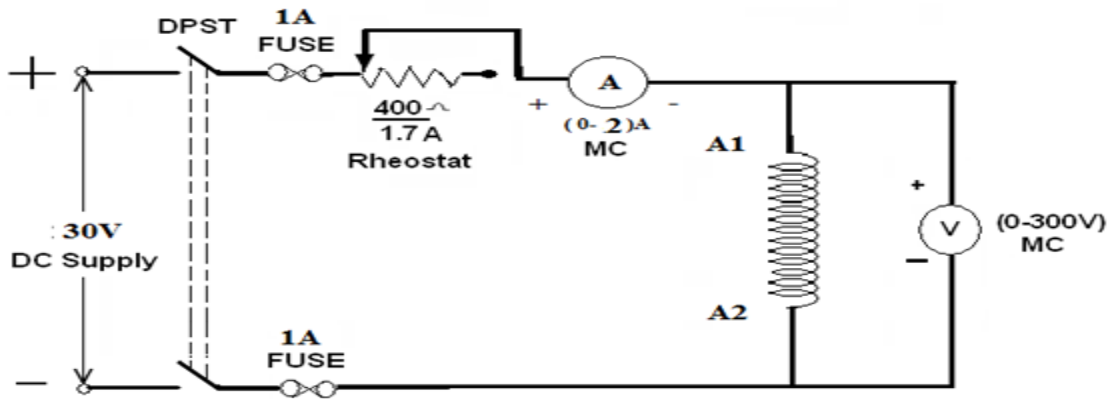

**To find stator Resistance:**

| S.No | I (A) | V (volts) | $R = \frac{V}{I} (\Omega)$ |
|------|-------|-----------|----------------------------|
|      |       |           |                            |
|      |       |           |                            |
|      |       |           |                            |
|      |       |           |                            |
|      |       |           |                            |
|      |       |           |                            |

Average Value:  $R_{dc}$   $R_{ac}$   $R_{dc} =$

**Comments:**

1. Since IM is not self starting Machine, it is started by placing an auxiliary winding in the circuit.
2. Here no-load test is similar to open circuiting the load terminals and blocking the rotor is similar to conducting short circuit on the IM.

**VIVA Questions:**

1. Why there is no starting torque in a single phase induction motor?
2. What are different starting methods employed in single phase induction motors?
3. Compare the performance of capacitor - start, capacitor – run, shaded pole single phase induction motors?
4. Mention a few applications of single phase induction motors?

**PRECAUTIONS:**

- Connections must be made tight
- Before making or breaking the circuit, supply must be switched off

## BRAKE TEST ON 3- $\phi$ SQUIRREL CAGE INDUCTION MOTOR

### AIM:

To determine the efficiency of 3-  $\phi$  induction motor by performing load test. To obtain the performance curves for the same.

### APPARATUS REQUIRED:

| Sl. No. | Equipment        | Type                      | Range                        | Quantity     |
|---------|------------------|---------------------------|------------------------------|--------------|
| 1       | Voltmeter        | MI                        | (0-600)V                     | 1 no         |
| 2       | Ammeter          | MI                        | (0-10)A                      | 1 no         |
| 3       | Wattmeter        | Electro dynamo meter type | 10A/600V UPF<br>10A/600V LPF | 1 no<br>1 no |
| 4       | Tachometer       | Digital                   | 0-9999 RPM                   | 1 no         |
| 5       | Connecting Wires | *****                     | *****                        | Required     |

### NAME PLATE DETAILS:

|              |  |
|--------------|--|
| Power rating |  |
| Voltage      |  |
| Current      |  |
| Speed(RPM)   |  |

|           |  |
|-----------|--|
| Frequency |  |
| PF        |  |

**3-  $\phi$  Auto transformer Details:**


Input Voltage: \_\_\_\_\_ (Volt)

Output Voltage: \_\_\_\_\_ (Volt)

Current: \_\_\_\_\_ (Amp.)

Freq.: \_\_\_\_\_ (Hz)

**CIRCUIT DIAGRAM:**

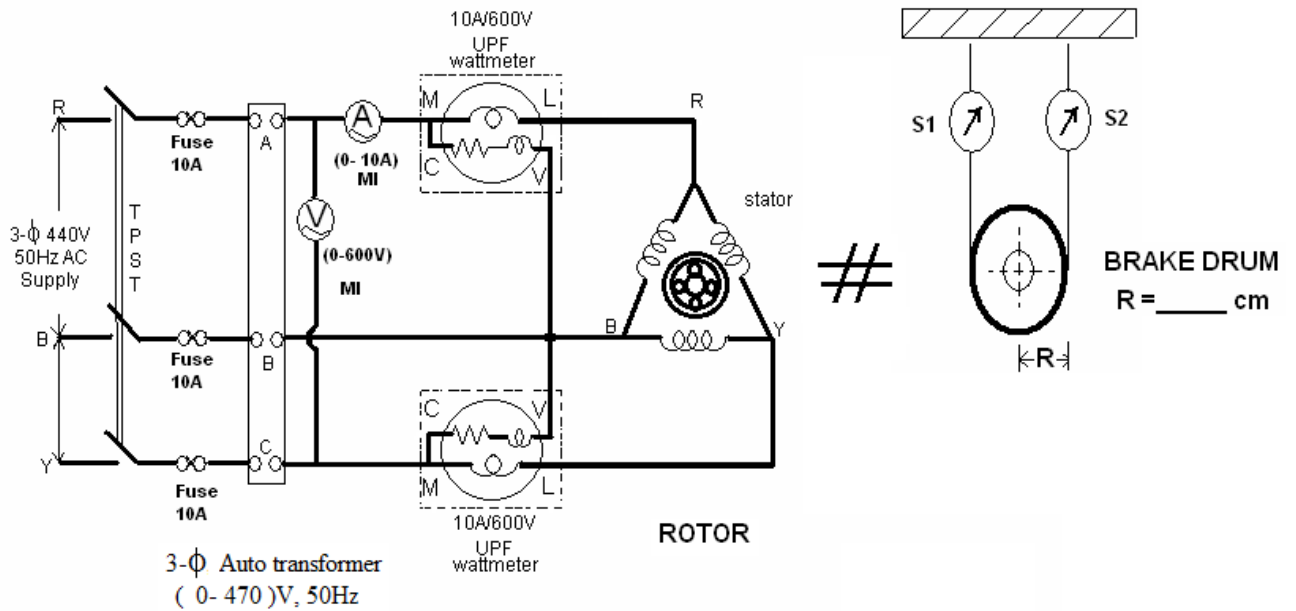

**PROCEDURE:**

1. Connections are made as per the circuit diagram.
2. Ensure that the 3-  $\phi$  variac is kept at minimum output voltage position and belt is freely suspended.



3. Switch ON the supply. Increase the variac output voltage gradually until rated voltage is observed in voltmeter. Note that the induction motor takes large current initially, so, keep an eye on the ammeter such that the starting current current should not exceed 7 Amp.
4. By the time speed gains rated value, note down the readings of voltmeter, ammeter, and wattmeter at no-load.
5. Now the increase the mechanical load by tightening the belt around the brake drum gradually in steps.
6. Note down the various meters readings at different values of load till the ammeter shows the rated current.
7. Reduce the load on the motor finally, and switch OFF the supply.

**MODEL CALCULATIONS:**

Input power drawn by the motor  $W = (W_1 \pm W_2)$  watts

Shaft Torque,  $T_{sh} = 9.81 (S_1 \sim S_2) R$  N-m                       $R \rightarrow$  Radius of drum in mts.

Output power in watts =  $\frac{2\pi N T_{sh}}{60}$  watts


% efficiency =  $\frac{\text{output power in watts}}{\text{Input power in watts}} \times 100$

% slip =  $\frac{N_s - N}{N_s} \times 100$                        $\left[ \text{where } N_s = \frac{120 \times f}{P} \right]$

power factor of the induction motor  $\cos \phi = \frac{W}{\sqrt{3} V_L I_L}$

**MODEL GRAPHS:**

1. Speed or slip Vs output power
2. Torque Vs output power
3. % efficiency Vs output power

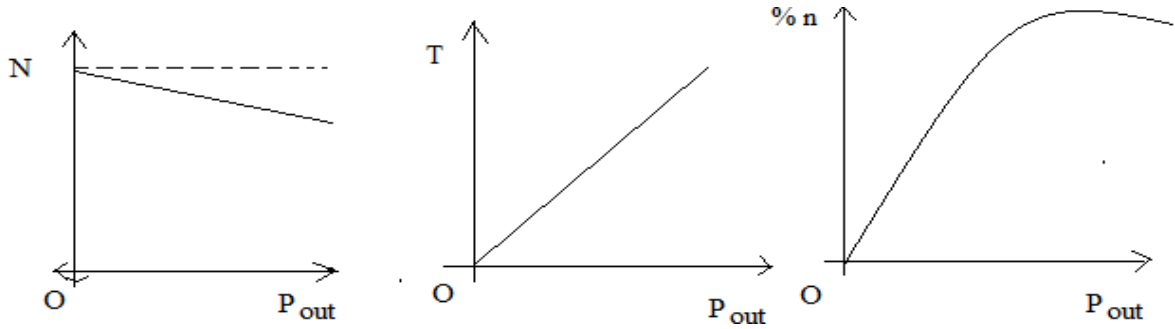

**OBSERVATIONS:**

| S. No. | V (Volts) | I (Amps) | Power, W (Watts) |                | Speed (RPM) | Torque (N-m) | Spring balance (Kg) |                | % Slip | Cos Ø | Output Power (W) | %η |
|--------|-----------|----------|------------------|----------------|-------------|--------------|---------------------|----------------|--------|-------|------------------|----|
|        |           |          | W <sub>1</sub>   | W <sub>2</sub> |             |              | S <sub>1</sub>      | S <sub>2</sub> |        |       |                  |    |
|        |           |          |                  |                |             |              |                     |                |        |       |                  |    |
|        |           |          |                  |                |             |              |                     |                |        |       |                  |    |
|        |           |          |                  |                |             |              |                     |                |        |       |                  |    |
|        |           |          |                  |                |             |              |                     |                |        |       |                  |    |
|        |           |          |                  |                |             |              |                     |                |        |       |                  |    |
|        |           |          |                  |                |             |              |                     |                |        |       |                  |    |
|        |           |          |                  |                |             |              |                     |                |        |       |                  |    |
|        |           |          |                  |                |             |              |                     |                |        |       |                  |    |
|        |           |          |                  |                |             |              |                     |                |        |       |                  |    |

**PRECAUTIONS:**

1. Connections must be made tight
2. Before making or breaking the circuit, supply must be switched off

**RESULT:**

**VIVA Questions:**

1. Why starter is used? What are different types of starters?
2. Compare a slip ring induction motor with cage induction motor?
3. Why the starting torque is zero for a Single Phase induction motor and non-zero of 3phase induction motor?
4. What are the disadvantages of this method?
5. Can we use rotor resistance method for starting?

## **SEPARATION OF NO LOAD LOSSES IN 1- $\Phi$ TRANSFORMER**

**AIM:**

To separation the Eddy current loss and Hysteresis loss from the iron loss of 1- $\Phi$  transformer.

**APPARATUS REQUIRED:**

| Sl. No. | Equipment        | Type                      | Range              | Quantity |
|---------|------------------|---------------------------|--------------------|----------|
| 1       | Voltmeter        | MI                        | (0-300)V           | 1 no     |
| 2       | Ammeter          | MC                        | (0-2.5)A           | 1 no     |
| 3       | Rheostat         | Wire-wound                | 370 $\Omega$ /1.7A | 1 no     |
|         |                  |                           | 150 $\Omega$ /2A   | 2 no     |
| 4       | Tachometer       | Digital                   | *****              | 1 no     |
| 5       | Wattmeter        | Electro dynamo meter type | 10A/600V LPF       | 1 no     |
| 6       | Connecting Wires | *****                     | *****              | Required |

**NAME PLATE DETAILS:**

|                              |  |
|------------------------------|--|
| <b>DC Motor(prime mover)</b> | <b>3- <math>\phi</math> Alternator</b> |
| KW :                         | Power Rating:                          |
| Voltage :                    | PF :                                   |
| Current :                    | Line voltage:                          |
| Speed :                      | Speed                                  |
| Exctn : Shunt                | Exctn Voltage:                         |

|                 |                 |
|-----------------|-----------------|
| Voltage :       | Rated Current : |
| Field current:: |                 |

**Transformer Specifications:**

Transformer Rating :( in KVA) \_\_\_\_\_

Winding Details:

LV (in Volts): \_\_\_\_\_


LV side current: \_\_\_\_\_

HV (in Volts): \_\_\_\_\_

HV side Current: \_\_\_\_\_

Type (Shell/Core): \_\_\_\_\_

**CIRCUIT DIAGRAM:**

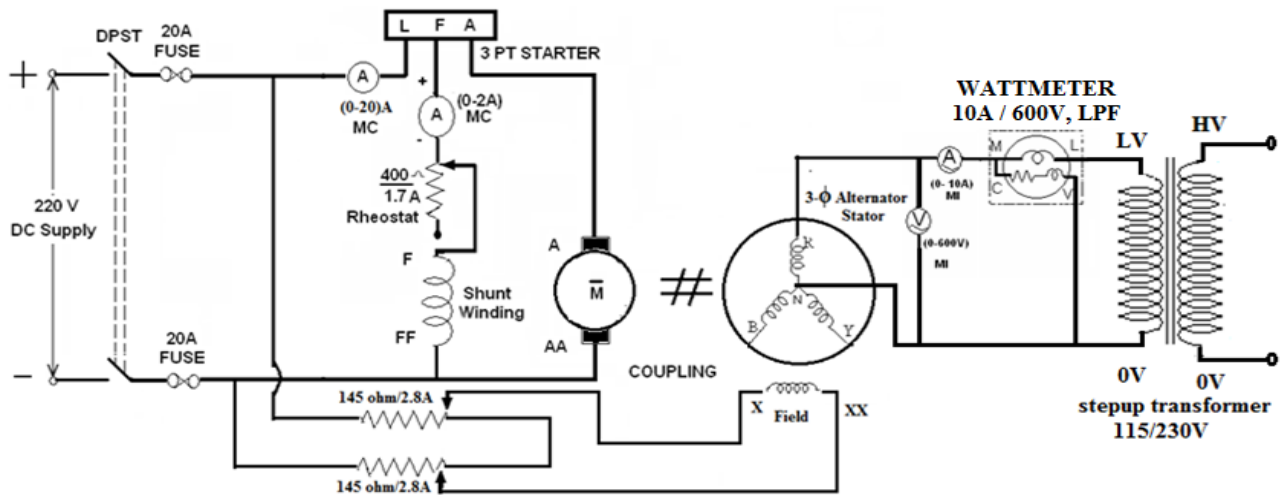

**PROCEDURE:**

1. Make the circuit connections as per the circuit diagram.
2. The prime mover is started with the help of 3-point starter and it is made to run at rated speed.

3. By varying alternators field rheostat gradually, the rated primary voltage is applied to transformer.
4. By adjusting the speed of prime mover the required frequency, is obtained and corresponding reading are noted.
5. The experiment is repeated for different frequency and corresponding readings are tabulated.
6. The prime mover is switched off using the DPIC switch after bringing all the rheostats to initial position
7. From the tabulated readings the iron loss is separated from eddy current loss and hysteresis loss by using respective formulae.

**OBSERVATIONS:**

**Separation of No load losses in single phase Transformer:**

Multiplication factor=


| S.No | Speed of the prime mover<br>N(rpm) | Supply frequency<br>(f)Hz | Primary voltage<br>(V)volts | Wattmeter readings(w) |                   | Iron or core loss<br>(W <sub>i</sub> )watts | W <sub>i</sub> /f |
|------|------------------------------------|---------------------------|-----------------------------|-----------------------|-------------------|---|-------------------|
|      |                                    |                           |                             | Observed<br>(watts)   | Actual<br>(watts) |   |                   |
|      |                                    |                           |                             |                       |                   |   |                   |

**CALCULATIONS:**

1. Frequency(f)= $\frac{PN_s}{120}$   
Where P-number of poles; N<sub>s</sub>-Synchronous speed in rpm
2. Hysteresis loss(W<sub>h</sub>)=Af
3. Eddy current loss(W<sub>e</sub>)=Bf<sup>2</sup>
4. Iron loss or core loss(W<sub>i</sub>)= W<sub>e</sub> +W<sub>h</sub>

**MODEL GRAPH:**

The graph drawn as frequency Vs(  $W_i/f$  )

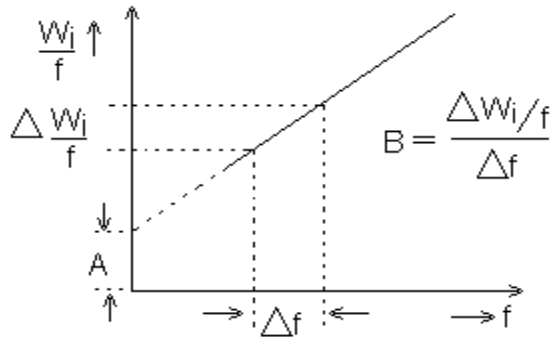**PRECAUTIONS:**

1. The motor field rheostat should be kept at minimum resistance position.
2. The alternator field rheostat should be kept maximum resistance position.
3. The motor should be run in anticlockwise direction.
4. Avoid loose connections.
5. Take the readings with any parallax error.

**VIVA Questions:**

1. What are core losses in a transformer? Why they occur? On what factors do they depend? What are the usual methods that are being employed in reducing them?
2. How does change in frequency affect the operation of a given transformer?
3. A transformer is designed for 50C/S operation. It is worked at double and half the designed frequency what changes do you expect in the performance? Discuss?
4. Whether you can excite a transformer from a DC supply of rated voltage Justify your answer

**PRECAUTIONS:**

1. Connections must be made tight
2. Before making or breaking the circuit, supply must be switched off

**RESULT:**



## DETERMINATION OF $X_d$ AND $X_q$ OF SALIENT POLE SYNCHRONOUS MOTOR

**AIM:**

To determine the direct axis reactance  $X_d$  and quadrature axis reactance  $X_q$  by conducting a slip test on a salient pole synchronous machine.

**APPARATUS REQUIRED:**

| Sl. No. | Equipment        | Type       | Range              | Quantity |
|---------|------------------|------------|--------------------|----------|
| 1       | Voltmeter        | MI         | (0-300)V           | 1 no     |
| 2       | Ammeter          | MI         | (0-5)A             | 1 no     |
| 3       | Rheostat         | Wire-wound | 400 $\Omega$ /1.7A | 1 no     |
| 4       | Tachometer       | Digital    | *****              | 1 no     |
| 5       | Connecting Wires | *****      | *****              | Required |

**NAME PLATE DETAILS:**

| DC Motor (prime mover) | 3- $\phi$ Alternator |
|------------------------|----------------------|
| KW :                   | Power Rating:        |
| Voltage :              | PF :                 |
| Current :              | Line voltage:        |
| Speed :                | Speed                |
| Exctn : Shunt          | Exctn Voltage:       |
| Voltage :              | Rated Current :      |
| Field current::        |                      |

**3-  $\phi$  Auto transformer Details:**


Input Voltage: \_\_\_\_\_(Volt)

Output Voltage: \_\_\_\_\_(Volt)

Current: \_\_\_\_\_(Amp.)

Frequency: \_\_\_\_\_(Hz)

**CIRCUIT DIAGRAM:**

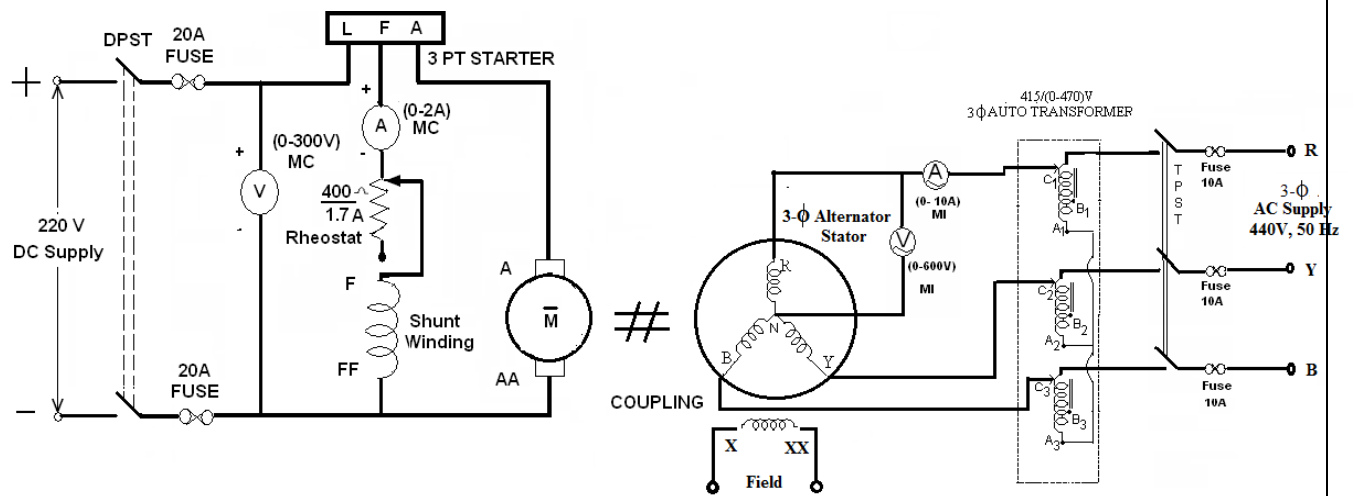

**PROCEDURE:**

1. Connections are made as per the circuit diagram.
2. Initially set field regulator, 3- $\phi$  variac at minimum position and TPST switch open.
3. The DC motor is started slowly by sliding starter handle and it is run at a speed slightly less than the synchronous speed of the alternator.
4. Close the TPST switch.
5. With field winding left open, a positive sequence balanced voltages of reduced magnitude (around 25% of rated Value) and of rated frequency are impressed across the armature terminals.

6. The prime mover (DC motor) speed is adjusted till ammeter and voltmeters pointers swing slowly between maximum and minimum positions.
7. Under this condition , readings of maximum and minimum values of both ammeter and voltmeter are recorded

**CALCULATIONS:**

$$X_d = \frac{\text{maximum armature terminal voltage per phase}}{\text{minimum armature current per phase}}$$

$$X_q = \frac{\text{minimum armature terminal voltage per phase}}{\text{maximum armature current per phase}}$$

**Note:**

1. When performing this test, the slip should be made as small as possible.
2. During Slip test, it is observed that swing of the ammeter pointer is very wide, whereas the voltmeter has only small swing.

**TABULAR COLUMN:**

| Sl no. | Speed | Vmax<br>(V <sub>L</sub> ) | Vmin<br>(V <sub>L</sub> ) | I <sub>max</sub><br>(I <sub>L</sub> ) | I <sub>min</sub><br>(I <sub>L</sub> ) | X <sub>d</sub> | X <sub>q</sub> |
|--------|-------|---------------------------|---------------------------|---------------------------------------|---------------------------------------|----------------|----------------|
|        |       |                           |                           |                                       |                                       |                |                |
|        |       |                           |                           |                                       |                                       |                |                |

**RESULT:**

